HOVMAND
LIFTING & MOVING TECHNOLOGY

Impact 70-80-130-200-INOX 200

Checking top limit switch.

Remove front cover. Take off 4-5 screws. Lift off the cover.

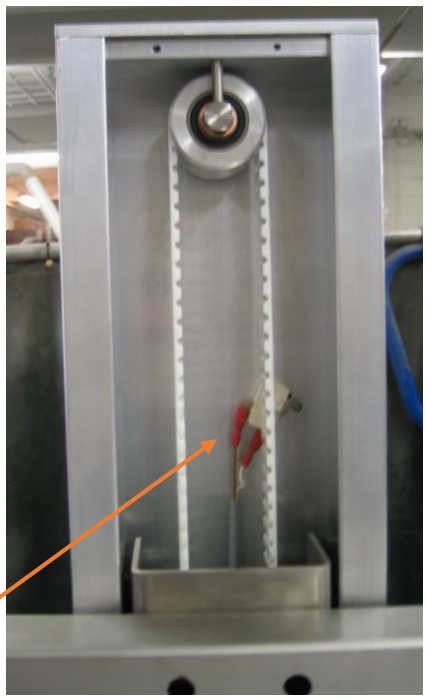

Impact 130

Top limit switch is located approx. 20 cm from the top.

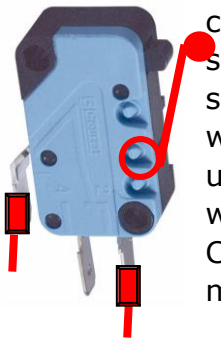

If UP don't work it is most likely a failure at the contact arm of the top limit switch. Test the switch by putting a wire across the top limit switch connections. Press UP button and if it works you can replace the top limit switch using a hexagon key 2,5mm. Make sure the wires are connected to the NC pins 1 & 4. Contact arm with roller shall be mounted in the middle position.